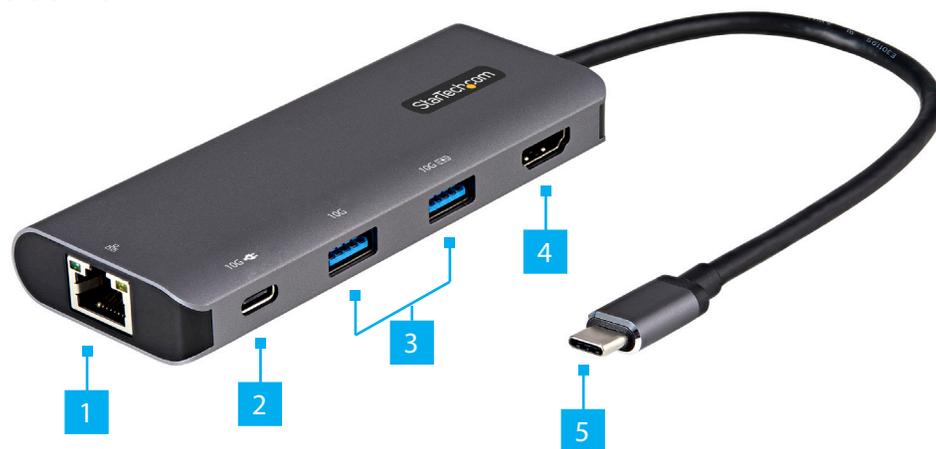**StarTech**.com
Hard-to-find **made easy**®

USB-C™ (10 Gbps) Multiport Adapter with HDMI, 85W Power Delivery Pass Through, GbE 2x USB-A & 1x USB-C

Product Diagram (DKT31CHPDL)

Side View

	Port	Function
1	RJ45 Port	• Connect a **Network Cable**
2	USB-C Port	• Connect a **USB-C Storage Device** (e.g. flash drive), or **USB-C Peripheral Device** • Connect the **Host Computer's Power Adapter** for **Power Delivery Pass Through**
3	USB-A Ports	• Connect a **USB-A Peripheral Device** • Charge a **USB-A Peripheral**
4	HDMI Output Port	• Connect an **HDMI Display Device**
5	USB-C Host Connector	• Connect to a **Laptop** or **Computer**

Requirements

For the latest requirements and to view the full manual, please visit: www.startech.com/DKT31CHPDL.

• Host Computer with USB-C Port

Installation

Powering the Multiport Adapter

USB Bus Power Mode (from Laptop):

The **Multiport Adapter** can be powered by the **Host Computer's USB-C Port** and does not require a separate power adapter for most device connections.

USB Power Delivery Pass Through Mode:

If you want to charge your **Laptop** through the **Multiport Adapter**, or need additional power to support a **USB Device** requiring more power, follow these steps:

1. Connect the **Multiport Adapter** to a **USB-C Port** on the **Host Computer** using the **USB-C Host Connector.**

2. Connect the **USB-C Connector** from the **Host Computer's Power Adapter** to the **USB-C Port** on the **Multiport Adapter**.

3. The **Host Computer's Power Adapter** will power the **Multiport Adapter** and pass power through to the **Host Computer**.

Windows 7 (and earlier) Driver Installation

1. If the **Found New Hardware** dialog box appears on your screen, close the dialog box or click **Cancel**.
   Note: Once the **Multiport Adapter** is connected to the **Computer**, if no existing **Drivers** are found, it will load a **CD-ROM Device** that contains an executable file that you can use to install the **Driver**.

2. After the **CD-ROM Device** finishes loading, run the **Installation File**.

3. Complete the on-screen instructions to finish the installation.

   Note: You can also download the latest software from the StarTech.com website, www.StarTech.com/DKT31CHPDL.

Connecting a Display

• Connect an **HDMI M/M Cable** to the **HDMI Output Port** on the **Multiport Adapter** and to the **HDMI Input Port** on the **HDMI Display Device**.

Connect to a Network

• Connect a **Network Cable** to the **RJ45 Port** on the **Multiport Adapter** and to the **Network Device**.

Connect USB Peripherals

- Connect a **USB-C Peripheral** to the **USB-C Port** on the **Multiport Adapter**.

- and/or -

- Connect **USB-A Peripherals** to the **USB-A Ports** on the **Multiport Adapter**.

Operation

RJ45 Port LED Indicators

LED Color	Status	Indication
Green	Solid	• Link speed is either 1000Mbps (1 GbE), 100Mbps, or 10Mbps
	Off	• No connection established
Amber	Flashing	• Network traffic detected
	Off	• No link established